


20. WIRING DIAGRAM

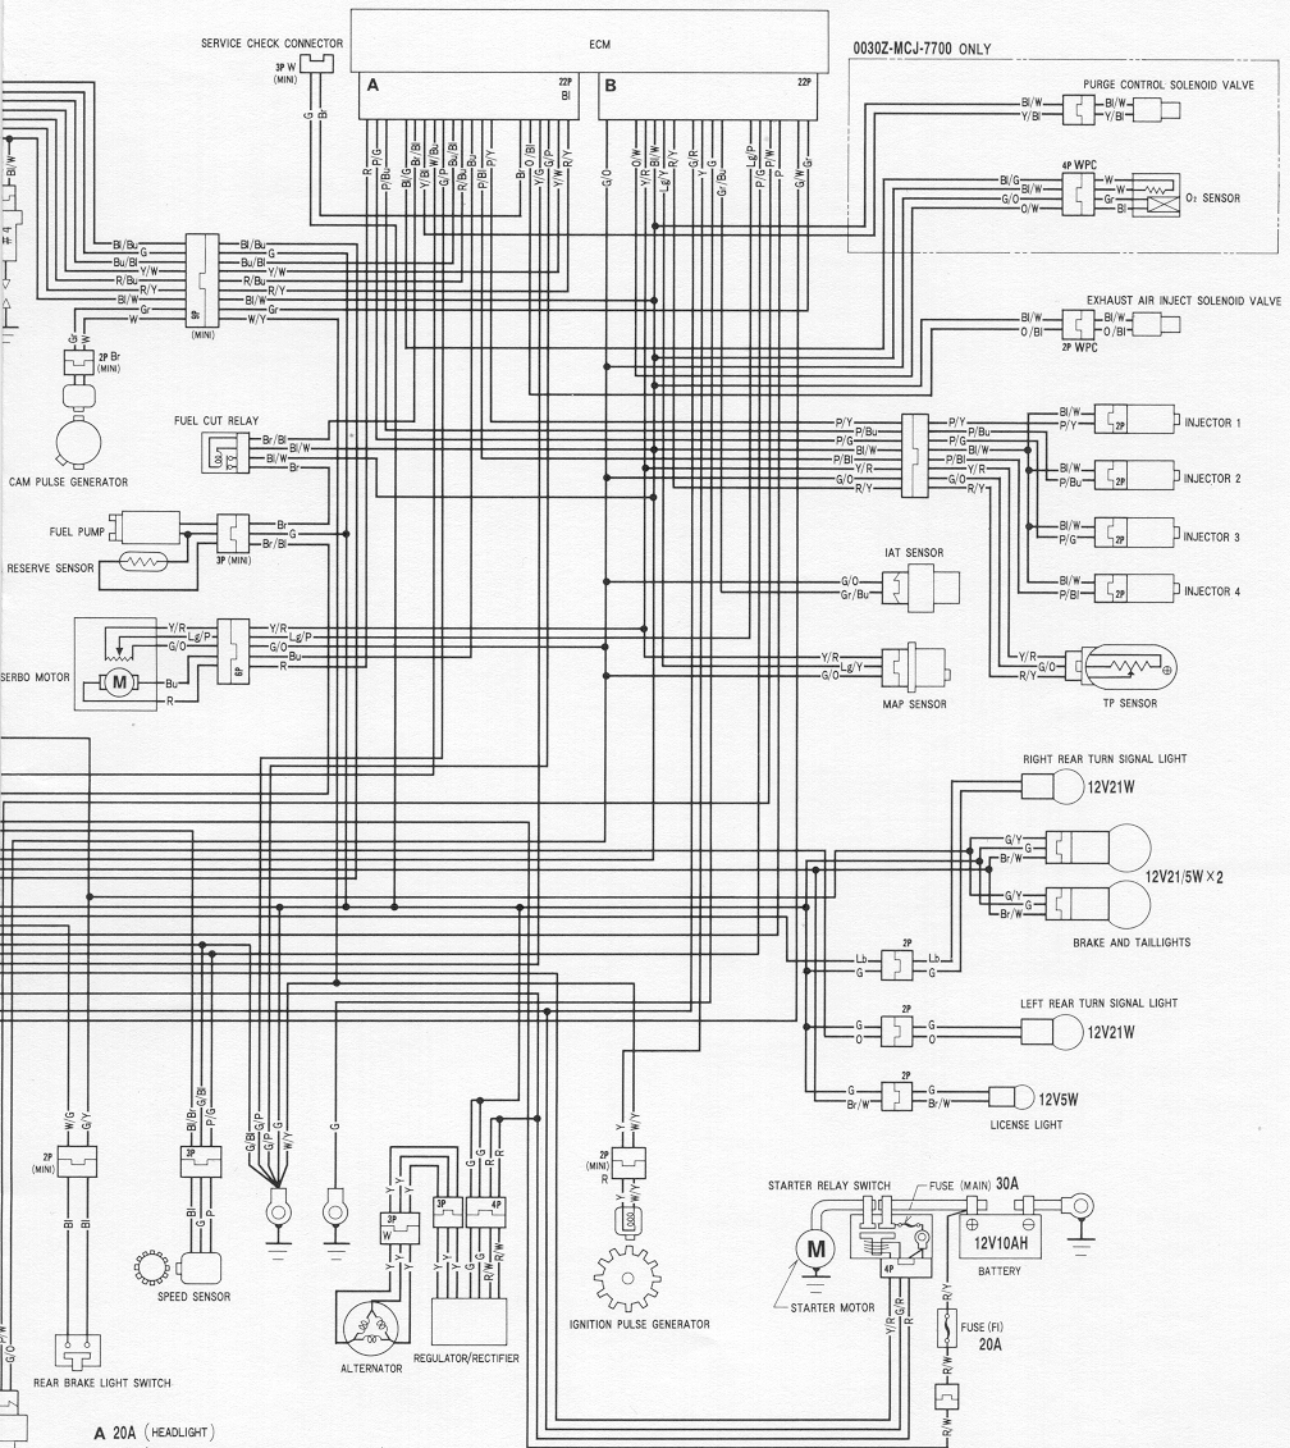

- A 20A (HEADLIGHT)
 B 10A (NEUTRAL • OIL • TEMP/METER • TACHOMETER • SPEEDOMETER • HORN • METER LIGHT • TAIL)
 C 10A (TURN SIGNAL • FRONT, REAR BRAKE)
 D 10A (IGNITION • STARTER)
 E 10A (FAN MOTOR)
 F 10A (CLOCK)

ENGINE STOP SWITCH		STARTER SWITCH			
IG	BAT2	ST	IG	BAT3	HL
OFF		FREE			
RUN		PUSH			
COLOR	BI W/BI	COLOR	Y/R BI	BI/Br Bu/W	

DWG. NO.	DESTINATION
0030Z-MCJ-6700	A, CM
0030Z-MCJ-7700	AC

BI	BLACK	Br	BROWN
Y	YELLOW	O	ORANGE
Bu	BLUE	Lb	LIGHT BLUE
G	GREEN	Lg	LIGHT GREEN
R	RED	P	PINK
W	WHITE	Gr	GRAY

**0030Z-MCJ-6700
-7700**